

Work Order ID 146592

Thursday, May 19, 2016 2:56:24 PM

146592

Page 1

Item ID: D206-642-341

Accept

N900040100

Setup Start

NS1

Revision ID:

Item Name: Replacement Skidtube (Fits LH or RH)

Stop

NS2

Start Date: 5/17/2016 Start Qty: 1.00

1

Cust Item ID:

Required Date: 5/28/2016 Req'd Qty: 1.00

1

Customer:

Reference:

Approvals: Process Plan: MLS Date: MAY 24 2016

Tooling:

Date:

Run Start

NR1

QC: Date:

SPC (Y/N):

Date:

Stop

NR2

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

Draw Nbr

Revision Nbr

D2650

F(DEO)

100

Document Control

0.00

100

DOCUMENT CONTROL

DC

Memo

0.00

Doc.Control -USB or Paperwork

Photocopy bluefile and create labels per PPP D206-642-341 CHG005

N/A
DAS
21
9-89

SEP 14 2016

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval		
Description Work Order Deviation				Disposition					

Root Cause				FAULT CATEGORY			
Environment ☐	☐	No Re-verification ☐	☐	Pressure/Forced ☐	☐	Temperature/Cure ☐	☐
Design ☐	☐	Operator ☐	☐	Bending ☐	☐	Set-up ☐	☐
Doc/Data ☐	☐	Offset/Setup ☐	☐	Centre Not Concentric ☐	☐	BOM/Route ☐	☐
Equip/Tooling ☐	☐	Supplier ☐	☐	Cracks ☐	☐	Broken/Damage/Defect ☐	☐
Handling/Pre ☐	☐	Training ☐	☐	Crimp/Kink/Ripple/Wave ☐	☐	Inspection Incomplete/Unqualified ☐	☐
Material ☐	☐	Use for Testing ☐	☐	Cuffs ☐	☐	Contamination ☐	☐
Internal Transport ☐	☐	Poor Information ☐	☐	Crushing ☐	☐	Countersink ☐	☐
Tribal Knowledge ☐	☐	Rushing ☐	☐	Heat Treat ☐	☐	Cut Too Short ☐	☐
LOA ☐	☐	Product Improvement ☐	☐	Wave/Twist in Tube ☐	☐	Instructions Incomplete/Unclear ☐	☐
Substation ☐	☐	Process Improvement ☐	☐	Marks/Chatter ☐	☐	Drill Holes ☐	☐
Past Expiry Date ☐	☐	Manufacturing Process ☐	☐	OTHER :			
Misidentified ☐	☐	Past Due ☐	☐				

Work Order ID 146592

Thursday, May 19, 2016 2:56:24 PM

146592

Page 2

Item ID: D206-642-341

Accept

N900040100Setup Start ***NS1***

Revision ID:

Stop ***NS2***

Item Name: Replacement Skidtube (Fits LH or RH)

Start Date: 5/17/2016 Start Qty: 1.00 ***1***

Cust Item ID:

Required Date: 5/28/2016 Req'd Qty: 1.00 ***1***

Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Run Start ***NR1***

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

110

0.00

110

Skidtubes

0.97

Skidtubes

Skidtubes

Memo

1-Deburr Fwd edge of tube

2-Remove ridge on inside of Fwd edge of tubeas per Dwg D2650

3-Weld Fwd Cap as per Dwg D2650. Use aluminum rod. Grind D2647 to fit as required.

A/RAluminum Rod m131562/MB4826

4-Grind weld flush to cap on top surface only.

5-Cut aft end to lenght as per dwg D2650

6-Drill pilot holes using drill Jig DT8168A (A,& B) and DT8025.

7-Drill holes for wearplates using DT 8028-5. Open to Ø 0.297

8-Open Aft Cap Hole using #6 Drill Bit

9-Open holes for Tow Ring to Ø0.625" as per Dwg D2650, D2650-5 Drilling Detail

10-Remove inner indexing ridge on aft end of skidtubeas per Dwg D2650

11- Ream holes to finished size as per Dwg D2650, D2650-5 Drilling Detail (without cutting fluid)

12-Deburr.

8E16-06-29

16-7-13 JH

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval		
Description Work Order Deviation				Disposition				Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval	
Root Cause		FAULT CATEGORY							
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐				
Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐				
Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐				
Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐				
Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐				
Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐				
Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐				
Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐				
LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐				
Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐				
Past Expiry Date ☐	Manufacturing Process ☐								
Misidentified ☐	Past Due ☐	OTHER : _____							

Thursday, May 19, 2016 2:56:24 PM

1 465.92

Page 3

N900040100

Setup Start *NS1*

Stop *NS2*

Start Date: 5/17/2016 **Start Qty:** 1.00 ***1***

Cust Item ID:

Required Date: 5/28/2016 **Req'd Qty:** 1.00 ***1***

Customer:

Reference:

Approvals: **Process Plan:** _____ **Date:** _____ **Tooling:** _____ **Date:** _____

Run Start *NR1*

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop *NR2*

**Insp.
Stamp**

QC5- Inspect part completeness to step on W/O

0.00

115

QC

Memo

0.02

Quality Control

DAS
9
9-89

QC9- Inspect visual per QSI004- Fusion Welds

0.00

1 1 6

QC

Memo

0.00

Quality Control

DAS
9
~~9-89~~

Chemical Conversion Coat per QSI005 4.1

0.00

1 20

HandFinish

Memo

0.46

Hand Finishing

2016/07/15
BEB

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐						
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval			
Description Work Order Deviation				Disposition				Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval		
Root Cause		FAULT CATEGORY								
Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐	No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐	Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐			Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐			Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center ☐		Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐
		OTHER : _____								

Thursday, May 19, 2016 2:56:24 PM

Page 4

Quality Control

Memo

0.02

Insp.
Stamp

1 Ø 16-07-18

1 Q 16-07-18

10 16-07-27

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval		
Description Work Order Deviation				Disposition					
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Misabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐							
		OTHER : ☐							

Work Order ID 146592

Thursday, May 19, 2016 2:56:24 PM

146592

Page 5

Item ID: D206-642-341**Accept*****N900040100*****Setup Start*****NS1*****Revision ID:****Item Name:** Replacement Skidtube (Fits LH or RH)**Stop*****NS2*****Start Date:** 5/17/2016 **Start Qty:** 1.00***1*****Cust Item ID:****Required Date:** 5/28/2016 **Req'd Qty:** 1.00***1*****Customer:****Reference:****Approvals:** **Process Plan:** _____ **Date:** _____ **Tooling:** _____ **Date:** _____**Run Start*****NR1*****QC:** _____ **Date:** _____ **SPC (Y/N):** _____ **Date:** _____**Stop*****NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
150	Skidtubes	0.00							
150									
Skidtubes	Memo	1.26							
Skidtubes	1- Insert D4720-1 Spacer. Swage to 0.313" X 0.75" DP per QSI 002. Trim and grind flush per QSI 002								
	2- Install nut plate as per dwg								
180	QC5- Inspect part completeness to step on W/O	0.00							
180									
QC	Memo	0.02							
Quality Control									
190	Pressure Wash per QSI005 4.3	0.00							
190									
HandFinish	Memo	0.58							
Hand Finishing									

16-7-27 MG

① 16-07-26

DAS
9
9-89

①

16-08-02
DAS
15
BEB

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐																																																													
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval																																																										
Description Work Order Deviation				Disposition				Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval																																																									
Root Cause		FAULT CATEGORY																																																															
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐	Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐	Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐	Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐	Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐	Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐	Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐	Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐	LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐	Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐	Past Expiry Date ☐	Manufacturing Process ☐	OTHER : ☐			
Misidentified ☐	Past Due ☐																																																																

Work Order ID 146592

Thursday, May 19, 2016 2:56:24 PM

146592

Page 6

Item ID: D206-642-341**Accept*****N900040100*****Setup Start *NS1*****Revision ID:****Stop *NS2*****Item Name:** Replacement Skidtube (Fits LH or RH)**Start Date:** 5/17/2016 **Start Qty:** 1.00 ***1*****Cust Item ID:****Required Date:** 5/28/2016 **Req'd Qty:** 1.00 ***1*****Customer:****Reference:****Approvals:** **Process Plan:** _____ **Date:** _____ **Tooling:** _____ **Date:** _____**Run Start *NR1*****QC:** _____ **Date:** _____ **SPC (Y/N):** _____ **Date:** _____**Stop *NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
200 *200* Powdercoat Powder Coating	White Gloss (Ref: 4.3.5.1) per QSI005 4.3-Alum <i>M 135418.</i> Memo Make sure Nut Plate Thread is protected using paint screw, and mask GHW studs. START TIME: <i>11:20</i> OVEN TEMPERATURE: <i>325°</i> FINISH TIME: <i>11:50</i>	0.00 0.12				<i>1</i>	<i>16.09.16</i>	<i>DAS 34 9-89</i>	
210 *210* QC Quality Control	QC3- Inspect Part Finish Memo	0.00 0.01						<i>12 of 20 16109108</i>	<i>DAS 15 9-89</i>

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐																																																													
Date :		Step #:		QTY Effective :				MRB (QSI042) Approval 																																																									
Description Work Order Deviation				Disposition																																																													
								Completed By																																																									
								Lead hand / Supervisor Approval Verification																																																									
								QC / QA Coordinator Approval																																																									
Root Cause		FAULT CATEGORY																																																															
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐	Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐	Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐	Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐	Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐	Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐	Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐	Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐	LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐	Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐	Past Expiry Date ☐	Manufacturing Process ☐	OTHER : _____			
Misidentified ☐	Past Due ☐																																																																

Work Order ID 146592

Thursday, May 19, 2016 2:56:24 PM

146592

Page 7

Item ID: D206-642-341 Accept ***N900040100*** Setup Start ***NS1***
Revision ID: Stop ***NS2***
Item Name: Replacement Skidtube (Fits LH or RH)
Start Date: 5/17/2016 Start Qty: 1.00 ***1*** Cust Item ID:
Required Date: 5/28/2016 Req'd Qty: 1.00 ***1*** Customer:
Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____ Run Start ***NR1***
QC: _____ Date: _____ SPC (Y/N): _____ Date: _____ Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
220	HandFinishing	0.00							
220	HandFinish	1.68							
Hand Finishing	Memo 1-Install inserts & wearpads as per dwg D2922. Use a drop of Sikaflex inside insert holes before installing wearpad/wearplate. A/RSikaflex-291 <u>M135326</u> Sikaflex expiry date: <u>16109</u> 2-Install O-Rings D2651-3 on plugs D2651-1 with Petroleum Jelly and install plugs as per Dwg D2650. Clean excess adhesive 3-Install MS27039-4-06 Screw 4-Inspect for foreign object per QSI 024 5-Install D2646 Aft Cap and seal with SikaflexClean excess adhesive A/RSikaflex-291 <u>M135326</u> Sikaflex expiry date: <u>16109</u> 6-Wing Walk as per Dwg D2650-5 and QSI 005 4.4 Batch: <u>M315317</u>								

Handwritten notes:
1k d
all 16109
RTU 598 M135426 16109

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval		
Description Work Order Deviation				Disposition				Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval	
Root Cause		FAULT CATEGORY							
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐				
Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐				
Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐				
Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐				
Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐				
Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐				
Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐				
Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐				
LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐				
Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐				
Past Expiry Date ☐	Manufacturing Process ☐								
Misidentified ☐	Past Due ☐	OTHER :							

Work Order ID 146592

Thursday, May 19, 2016 2:56:24 PM

146592

Page 8

Item ID: D206-642-341**Accept*****N900040100*****Setup Start*****NS1*****Revision ID:****Item Name:** Replacement Skidtube (Fits LH or RH)**Stop*****NS2*****Start Date:** 5/17/2016 **Start Qty:** 1.00 ***1*****Cust Item ID:****Required Date:** 5/28/2016 **Req'd Qty:** 1.00 ***1*****Customer:****Reference:****Approvals:** **Process Plan:** _____ **Date:** _____ **Tooling:** _____ **Date:** _____**Run Start*****NR1*****QC:** _____ **Date:** _____ **SPC (Y/N):** _____ **Date:** _____**Stop*****NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
230 *230* QC Quality Control	QC3- Inspect Part Finish Memo	0.00 0.01				1			DAS 38 9-89 SEP 09 2016
240 *240* QC Quality Control	QC5- Inspect part completeness to step on W/O Memo	0.00 0.02				1			DAS 38 9-89 SEP 09 2016
250 *250* Packaging Packaging	Packaging Memo Identify and pack for shipping as per PPP D206-642-341 Location:FG083	0.00 0.00							DAS 6 9-89 SEP 14 2016 PPD 148324



Work Order update only

Work Order: _____		DISPOSITION		AGAINST DEPARTMENT/PROCESS								
Part No. _____		Rework	☐	Skid-tube	☐	Cross tube	☐	Water Jet	☐	Engineering	☐	
NCR No. _____		Scrap	☐	Machining	☐	Small Fab	☐	Prod. Eng. Coord.	☐	Quality	☐	
		Use-as-is	☐	Thermoforming	☐	Finishing	☐	Rec/Store/Packaging	☐	Other	☐	
		Suspected Unapproved	☐	Large Fab	☐	Composite	☐	Supplier	☐		☐	
Date :	Step #:	QTY Effective :							MRB (QS1042) Approval			
Description Work Order Deviation				Disposition								
											Completed By	
											Lead hand / Supervisor Approval Verification	
											QC / QA Coordinator Approval	
Root Cause				FAULT CATEGORY								
Environment	☐	No Re-verification	☐	Pressure/Forced	☐	Temperature/Cure	☐	Power Loss/Surge	☐	Positioned Wrong	☐	
Design	☐	Operator	☐	Bending	☐	Set-up	☐	Folio/Program	☐	Outside Dimensions	☐	
Doc/Data	☐	Offset/Setup	☐	Centre Not Concentric	☐	BOM/Route	☐	Grain	☐	Over/Under tolerance	☐	
Equip/Tooling	☐	Supplier	☐	Cracks	☐	Broken/Damage/Defect	☐	Weld	☐	Part Incorrect	☐	
Handling/Pre	☐	Training	☐	Crimp/Kink/Ripple/Wave	☐	Inspection Incomplete/Unqualified	☐	Wrong Stock Pulled	☐	Part Lost/Missing	☐	
Material	☐	Use for Testing	☐	Cuffs	☐	Contamination	☐	Out of Sequence	☐	Part Moved	☐	
Internal Transport	☐	Poor Information	☐	Crushing	☐	Countersink	☐	Off-set	☐	Drawing	☐	
Tribal Knowledge	☐	Rushing	☐	Heat Treat	☐	Cut Too Short	☐	Mislabeled	☐	Finish	☐	
LOA	☐	Product Improvement	☐	Wave/Twist in Tube	☐	Instructions Incomplete/Unclear	☐	Fit/Function	☐	Misread	☐	
Substation	☐	Process Improvement	☐	Marks/Chatter	☐	Drill Holes	☐	Misaligned/off center	☐	Turning Sequence	☐	
Past Expiry Date	☐	Manufacturing Process	☐									
Misidentified	☐	Past Due	☐	OTHER : _____								

Work Order ID 146592

Thursday, May 19, 2016 2:56:24 PM

146592

Page 9

Item ID: D206-642-341**Accept*****N900040100*****Setup Start *NS1*****Revision ID:****Item Name:** Replacement Skidtube (Fits LH or RH)**Stop *NS2*****Start Date:** 5/17/2016 **Start Qty:** 1.00 ***1*****Cust Item ID:****Required Date:** 5/28/2016 **Req'd Qty:** 1.00 ***1*****Customer:****Reference:****Approvals:** **Process Plan:** _____ **Date:** _____ **Tooling:** _____ **Date:** _____**Run Start *NR1*****QC:** _____ **Date:** _____ **SPC (Y/N):** _____ **Date:** _____**Stop *NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
260	QC21- Final Inspection - Work Order Release	0.00							
260									
QC	Memo	0.10							
Quality Control									

DAS
21
9-89

SEP 14 2016

DAS
21
9-89

SEP 14 2016

DQA: _____ Date: _____

WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date : _____	Step #: _____	QTY Effective : _____		MRB (QSI042) Approval Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval	
Description Work Order Deviation		Disposition			

Root Cause				FAULT CATEGORY			
Environment ☐	☐	No Re-verification ☐		Pressure/Forced ☐	☐	Temperature/Cure ☐	☐
Design ☐	☐	Operator ☐		Bending ☐	☐	Set-up ☐	☐
Doc/Data ☐	☐	Offset/Setup ☐		Centre Not Concentric ☐	☐	BOM/Route ☐	☐
Equip/Tooling ☐	☐	Supplier ☐		Cracks ☐	☐	Broken/Damage/Defect ☐	☐
Handling/Pre ☐	☐	Training ☐		Crimp/Kink/Ripple/Wave ☐	☐	Inspection Incomplete/Unqualified ☐	☐
Material ☐	☐	Use for Testing ☐		Cuffs ☐	☐	Contamination ☐	☐
Internal Transport ☐	☐	Poor Information ☐		Crushing ☐	☐	Countersink ☐	☐
Tribal Knowledge ☐	☐	Rushing ☐		Heat Treat ☐	☐	Cut Too Short ☐	☐
LOA ☐	☐	Product Improvement ☐		Wave/Twist in Tube ☐	☐	Instructions Incomplete/Unclear ☐	☐
Substation ☐	☐	Process Improvement ☐		Marks/Chatter ☐	☐	Drill Holes ☐	☐
Past Expiry Date ☐	☐	Manufacturing Process ☐		OTHER : _____			
Misidentified ☐	☐	Past Due ☐					

Picklist Print

Thursday, May 19, 2016 2:56:22 PM

Page 1
18

Work Order ID: 146592

146592

Parent Item: D206-642-341

D206-642-341

Parent Item Name: Replacement Skidtube (Fits LH or RH)

Start Date: 5/17/2016

Required Date: 5/28/2016

Start Qty: 1.00

Required Qty: 1.00

Comments: IPP Rev: H 05.10.11 Added D3429-1 per CHG004 KJ/CP/JLM
IPP Rev: I 08-09-29 revF as per dwg DD verified by: EC Est Rev: J 09-03-02 as per DSI9440 rev.a DD verified by: EC IPP rev K 10.08.03 chg ms27039-1-08 for "C" type EC verf: DD IPP Rev: L 12.11.22 now swage per ecn12-679 DD verf: JLM IPP Rev: M 14.04.25 ECN14-520 DD verf: JLM

Component Item ID/ Item Name	Replacement Item ID	Mfg/ Purch	Bin Item	Primary Location	Last Location	Route Seq ID	Unit of Measure	Qty on Hand	Qty per Kit	Total Qty	Qty Issued	Date Issued	Status
ALS4-1032-130	AELS4-1032-130	Purchased	No			220	Each	4,284.000	54	54			
ALS4-1032-130										**		11/16/08	
Rivnut													

Location	Loc Qty	Loc Code
CCK005	2850	
M134502	2850	
FP001	1434	
M133077	140	
M134502	1294	

CCR264SS3-3 CCR264SS-3-03 Purchased No

CCR264SS3-3

Cherry Rivet

CR3212-4-03

Purchased No

CR3212-4-03

Cherry Rivet

Location	Loc Qty	Loc Code
ST320	218	
119017	218	

D2620 Manufactured No

D2620

Skidtube, 206 Skidtube

Location	Loc Qty	Loc Code
LG002	10	
141286	10	

DQA: _____ Date: _____

WORK ORDER NON-CONFORMANCE / UPDATE



QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval		
Description Work Order Deviation				Disposition				Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval	
Root Cause		FAULT CATEGORY							
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐				
Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐				
Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐				
Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐				
Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐				
Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐				
Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐				
Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐				
LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐				
Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐				
Past Expiry Date ☐	Manufacturing Process ☐								
Misidentified ☐	Past Due ☐	OTHER : _____							

Picklist Print

Thursday, May 19, 2016 2:56:22 PM

Page 2

Work Order ID: 146592

146592

Parent Item: D206-642-341

D206-642-341

Parent Item Name: Replacement Skidtube (Fits LH or RH)

Start Date: 5/17/2016

Required Date: 5/28/2016

Start Qty: 1.00

Required Qty: 1.00

D2646

Manufactured No

220

Each

64.0000

1

1

D2646

Aft Cap

**

del 16/09/09

Location

Loc Qty

Loc Code

FG

4

85848

2

90495

2

FP001

60

127924

1

136885

27

141214

32

Each

20.0000

1

**

del 16-06-29

D2647

Manufactured No

D2647

Cap

Location

Loc Qty

Loc Code

LG001

20

136125

20

Each

189.0000

14

14

**

del 16/09/09

D2651-1

Manufactured No

D2651-1

Plug

Location

Loc Qty

Loc Code

FP001

189

134571

10

136097

100

142456

79

B144659

del

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval Completed By _____ Lead hand / Supervisor Approval Verification _____ QC / QA Coordinator Approval _____		
Description Work Order Deviation				Disposition					

Root Cause				FAULT CATEGORY							
Environment ☐	☐	No Re-verification ☐		☐	Pressure/Forced	☐	Temperature/Cure	☐	Power Loss/Surge	☐	Positioned Wrong
Design ☐	☐	Operator ☐		☐	Bending	☐	Set-up	☐	Folio/Program	☐	Outside Dimensions
Doc/Data ☐	☐	Offset/Setup ☐		☐	Centre Not Concentric	☐	BOM/Route	☐	Grain	☐	Over/Under tolerance
Equip/Tooling ☐	☐	Supplier ☐		☐	Cracks	☐	Broken/Damage/Defect	☐	Weld	☐	Part Incorrect
Handling/Pre ☐	☐	Training ☐		☐	Crimp/Kink/Ripple/Wave	☐	Inspection Incomplete/Unqualified	☐	Wrong Stock Pulled	☐	Part Lost/Missing
Material ☐	☐	Use for Testing ☐		☐	Cuffs	☐	Contamination	☐	Out of Sequence	☐	Part Moved
Internal Transport ☐	☐	Poor Information ☐		☐	Crushing	☐	Countersink	☐	Off-set	☐	Drawing
Tribal Knowledge ☐	☐	Rushing ☐		☐	Heat Treat	☐	Cut Too Short	☐	Mislabeled	☐	Finish
LOA ☐	☐	Product Improvement ☐		☐	Wave/Twist in Tube	☐	Instructions Incomplete/Unclear	☐	Fit/Function	☐	Misread
Substation ☐	☐	Process Improvement ☐		☐	Marks/Chatter	☐	Drill Holes	☐	Misaligned/off center	☐	Turning Sequence
Past Expiry Date ☐	☐	Manufacturing Process ☐		OTHER : _____							
Misidentified ☐	☐	Past Due ☐									

Picklist Print

Thursday, May 19, 2016 2:56:23 PM

Page 3

Work Order ID: 146592

146592

Parent Item: D206-642-341

D206-642-341

Parent Item Name: Replacement Skidtube (Fits LH or RH)

Start Date: 5/17/2016

Required Date: 5/28/2016

Start Qty: 1.00

Required Qty: 1.00

D2651-3

Manufactured No

220

Each

301.0000

14

14

D2651-3

O-Ring

**

all 140908

Location

Loc Qty

Loc Code

FP001

301

120110

200

135359

91

141702

10

x 14

D2654-5

Manufactured No

Each

5.0000

1

D2654-5

Web

**

16-07-18 R.2.

Location

Loc Qty

Loc Code

LG002

5

140999

2

141197

3

1

D2680-041

Manufactured No

Each

21.0000

1

D2680-041

Nut Plate

**

16-7-27 Jk

Location

Loc Qty

Loc Code

LG001

21

136184

2

141543

19

1

DQA: _____ Date: _____

**WORK ORDER NON-CONFORMANCE / UPDATE**

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date :	Step #:	QTY Effective :		MRB (QSI042) Approval	
Description Work Order Deviation		Disposition			
				Completed By	
				Lead hand / Supervisor Approval Verification	
				QC / QA Coordinator Approval	
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐			
OTHER : ☐					

Picklist Print

Thursday, May 19, 2016 2:56:23 PM

Page 4

Work Order ID: 146592

146592

Parent Item: D206-642-341

D206-642-341

Parent Item Name: Replacement Skidtube (Fits LH or RH)

Start Date: 5/17/2016

Required Date: 5/28/2016

Start Qty: 1.00

Required Qty: 1.00

D3537-1

Manufactured No

220

Each

80.0000

6

6

D3537-1

Wearpad

**

all 16/06/08

Location

Loc Qty

Loc Code

FG

14

B146064

X3

79833

4

B148732

X3

88562

10

FP001

48

141922

9

142912

39

Return2016

9

107384

9

ST184

9

105680

4

107384

4

125911

1

D3537-3

Manufactured No

220

Each

59.0000

1

1

D3537-3

Wearpad

**

all 16/06/08

Location

Loc Qty

Loc Code

FG

8

86237

8

FP001

46

141220

15

141921

31

X1

Return2016

2

104350

1

120646

1

ST184

3

103628

1

103633

1

120646

1

Thursday, May 19, 2016 2:56:23 PM

Shop Packet Print

Page 4

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date : _____	Step #: _____	QTY Effective : _____		MRB (QSI042) Approval	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor Approval Verification	
				QC / QA Coordinator Approval	
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Misabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐			
OTHER : _____					

Picklist Print

Thursday, May 19, 2016 2:56:23 PM

Page 5

Work Order ID: 146592

146592

Parent Item: D206-642-341

D206-642-341

Parent Item Name: Replacement Skidtube (Fits LH or RH)

Start Date: 5/17/2016

Required Date: 5/28/2016

Start Qty: 1.00

Required Qty: 1.00

D4720-1

Manufactured No

150

Each

265.0000

19

19

D4720-1

Spacer

**

16-7-27 MG

Location

Loc Qty

Loc Code

LG001

265

129566

10

141321

255

Each

17.0000

1

D4956-11

Manufactured No

D4956-11

Wearplate Fwd

**

all 16/09/08

Location

Loc Qty

Loc Code

FP001

17

141198

17

Each

3.0000

1

D4956-23

Manufactured No

D4956-23

Wearplate Center Fwd

**

all 16/09/08

Location

Loc Qty

Loc Code

FP002

3

141623

3

Each

24.0000

1

D4956-35

Manufactured No

D4956-35

Wearplate Aft

**

all 16/09/08

Location

Loc Qty

Loc Code

FP002

24

139093

3

142432

21

1

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval		
Description Work Order Deviation				Disposition				Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval	
Root Cause		FAULT CATEGORY							
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐				
Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐				
Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐				
Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐				
Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐				
Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐				
Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐				
Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐				
LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐				
Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐				
Past Expiry Date ☐	Manufacturing Process ☐								
Misidentified ☐	Past Due ☐	OTHER : _____							

Picklist Print

Thursday, May 19, 2016 2:56:23 PM

Page 6

Work Order ID: 146592

146592

Parent Item: D206-642-341

D206-642-341

Parent Item Name: Replacement Skidtube (Fits LH or RH)

Start Date: 5/17/2016

Required Date: 5/28/2016

Start Qty: 1.00

Required Qty: 1.00

MS27039-1-08

Purchased

No

Each

508.0000

2

MS27039-1-08

Screw

ll 1609109

Location

Loc Qty

Loc Code

FP001

83

m128636

83

GA

73

125654

2

m128636

71

x2

ST281

352

m134502

52

m134762

300

MS27039-4-06

Purchased

No

220

Each

61.0000

1

1

MS27039-4-06

Screw

ll 1609109

Location

Loc Qty

Loc Code

FP001

56

m132317

56

x1

ST279

5

m126534

5

MS27039C1-08

Purchased

No

Each

628.0000

54

MS27039C1-08

SCREW

ll 1609109

Location

Loc Qty

Loc Code

FP001

262

m132317

120

m134370

142

M135127

x41

over006

250

m134166

250

x13

ST277

116

m126284

44

m132317

72

Thursday, May 19, 2016 2:56:23 PM

Shop Packet Print

Page 6

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval		
Description Work Order Deviation				Disposition					
Root Cause		FAULT CATEGORY							
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐				
Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐				
Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐				
Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐				
Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐				
Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐				
Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐				
Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐				
LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐				
Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐				
Past Expiry Date ☐	Manufacturing Process ☐	OTHER : _____							
Misidentified ☐	Past Due ☐								

Picklist Print

Thursday, May 19, 2016 2:56:23 PM

Page 7

Work Order ID: 146592

146592

Parent Item: D206-642-341

D206-642-341

Parent Item Name: Replacement Skidtube (Fits LH or RH)

Start Date: 5/17/2016

Required Date: 5/28/2016

Start Qty: 1.00

Required Qty: 1.00

NAS1149C0332R

Purchased

No

220

Each

4,395.000

54

54

NAS1149C0332R

WASHER

**

all 16/05/16

Location

Loc Qty

Loc Code

FP001

2048

M135274

154

m132262

4

m132930

1004

m134063

26

m134073

128

m134574

886

GA

173

m133284

173

ST266

2174

m134474

74

m134654

100

m134736

2000

NAS1149D0332J

Purchased

No

220

Each

941.0000

2

2

NAS1149D0332J

Washer

**

all 16/05/16

Location

Loc Qty

Loc Code

CA

6

m129682

6

M134848

12

FP001

49

m133988

1

m134502

48

ST260a

600

m134738

600

ST264

286

m134502

286

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date :	Step #:	QTY Effective :		MRB (QSI042) Approval	
Description Work Order Deviation		Disposition		Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval	
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Misabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐			
OTHER : ☐					

Picklist Print

Thursday, May 19, 2016 2:56:23 PM

Page 8

Work Order ID: 146592

146592

Parent Item: D206-642-341

D206-642-341

Parent Item Name: Replacement Skidtube (Fits LH or RH)

Start Date: 5/17/2016

Required Date: 5/28/2016

Start Qty: 1.00

Required Qty: 1.00

NAS1149D0463J

Purchased

No

Each

3,255.000

1

NAS1149D0463J

ll 6/09/08

WASHER

Location

Loc Qty

Loc Code

GA

146

M135390

XL

M132035

21

M134508

125

ST260a

2600

M134754

2600

ST263

509

M134634

509

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval		
Description Work Order Deviation				Disposition				Completed By	
								Lead hand / Supervisor Approval Verification	
Root Cause		FAULT CATEGORY							
Environment ☐	☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐			
Design ☐	☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐			
Doc/Data ☐	☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐			
Equip/Tooling ☐	☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐			
Handling/Pre ☐	☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐			
Material ☐	☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐			
Internal Transport ☐	☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐			
Tribal Knowledge ☐	☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐			
LOA ☐	☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐			
Substation ☐	☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐			
Past Expiry Date ☐	☐	Manufacturing Process ☐	OTHER : _____						
Misidentified ☐	☐	Past Due ☐							

QTY -1	QTY -3	QTY -5	QTY -7	PART NUMBER	DESCRIPTION
X				D2650-1	SKIDTUBE ASSEMBLY
	X			D2650-3	SKIDTUBE ASSEMBLY
		X		D2650-5	SKIDTUBE ASSEMBLY
			X	D2650-7	SKIDTUBE ASSEMBLY
1	1	1	1	D2600-1-160	EXTRUSION
1				D2654-1	WEB
	1			D2654-3	WEB
		1		D2654-5	WEB
			1	D2654-7	WEB
1	1	1	1	D2646	AFT CAP
1	1	1	1	D2647	CAP
17	18	19	23	D2649	CROSS BOLT SPACER
16	18	14	22	D2651-1	PLUG
16	18	14	22	D2651-3	O-RING
1	1	1	1	D2680-041	NUT PLATE
2	2			D3286-1	DOUBLER
2	2			D3286-3	STUD
42	44	54	60	ALS7-1032-130	INSERT (or AKS4-1032-130, ALS4-1032-130, ALS7-1032-130)
2	2	2	2	AN960JD10L	WASHER
2	2	2	2	CCR264SS3-3	RIVET
2	2	2	2	CR3212-4-03	RIVET
2	2	2	2	MS27039-1-08	SCREW
1	1	1	1	MS27039-4-06	SCREW
1	1	1	1	AN960JD416	WASHER
52	52			CR3212-4-04	RIVET

F

NOTES:

- 1) MATERIAL: N/A
- 2) FINISH: -CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
-POWDER COAT WHITE (4.3.5.1) PER DART QSI 005 4.3
-BLACK ANTI-SKID PAINT AS INDICATED TO 0.5 ABOVE LOCATION RIDGE PER DART QSI 005 4.4
- 3) TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED
- 5) BREAK SHARP EDGES: 0.005 TO 0.010 MAX
- 6) IDENTIFICATION: NONE
- 7) WEIGHT: N/A
- 8) WELD PER DART QSI 004
- 9) DAMAGE TOLERANCE ON FWD BEND:
THERE SHOULD BE NO VISIBLE WRINKLES IN THE BEND FROM THE GROUND TO A HEIGHT OF 5 INCHES ABOVE THE GROUND. IT IS ACCEPTABLE TO POLISH OUT GOUGES UP TO 0.020 DEEP IN THE BENT PORTION OF THE TUBE. A MAXIMUM REDUCTION IN DIAMETER OF 0.150" IS ACCEPTABLE IN THE BENT PORTION OF THE TUBE.
- 10) BOND WEB INTO OUTER TUBE WITH SIKAFLEX-241/-291 ADHESIVE PER DART QSI 015
- 11) INSERT D2651-1 PLUG C/W D2651-3 O-RING IN HOLES MARKED 'P' (BOTH SIDES OF TUBE)
- 12) DRILL Ø0.297 FOR ALS7-1032-130 INSERTS USING TEMPLATE DT8056-1 ON -1 TUBE, DT8056-3 ON -3 TUBE, DT8056-5 ON -5 TUBE, AND DT8056-7 ON -7 TUBE. INSTALL INSERTS AFTER FINISH.
- 13) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED


SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER

NO 146592 MJS
16-05-24


DEO ATTACHED

RELEASED
08-07-23 MJS

F	DRAWING UPDATED TO CURRENT STANDARDS. SHT 6 ADDED. ALL SECTION AND DETAIL VIEWS TRANSFERRED TO SHT 6. SHT 1 IN PL PART D2649 QTY UPDATED. SHT 6 SECT C-C GRIND INSTRUCTIONS DELETED FROM NOTE 7 (SEE NCR 239).	AJS	08.08.08
E	REMOVE CBORE, CHG DRILL. ADD CHAMFER	CP	06.03.30
D	REDRAW; INCGRP. DE09136/9153/9163 MOD GROUND HANDLING ON D2650-1/-3	CP	04.05.17
C	CHANGE HOLE PATTERN AND FRONT END	DS	97.10.29
B	AS MANUFACTURED CHANGES	DS	97.06.26
A	NEW ISSUE	DS	97.03.25
REV.	DESCRIPTION	BY	DATE
DESIGN	DS	DART AEROSPACE USA, INC	
DRAWN	AJS	PORT HADLOCK, WA	
CHECKED		DRAWING NO.	REV. F
MFG. APPR.		D2650	SHEET 1 OF 6
APPROVED		TITLE	SCALE
DE APPR.		206/407 SKIDTUBE ASSEMBLIES	NTS
DATE	08.08.08	COPYRIGHT © 1997 BY DART AEROSPACE USA, INC THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

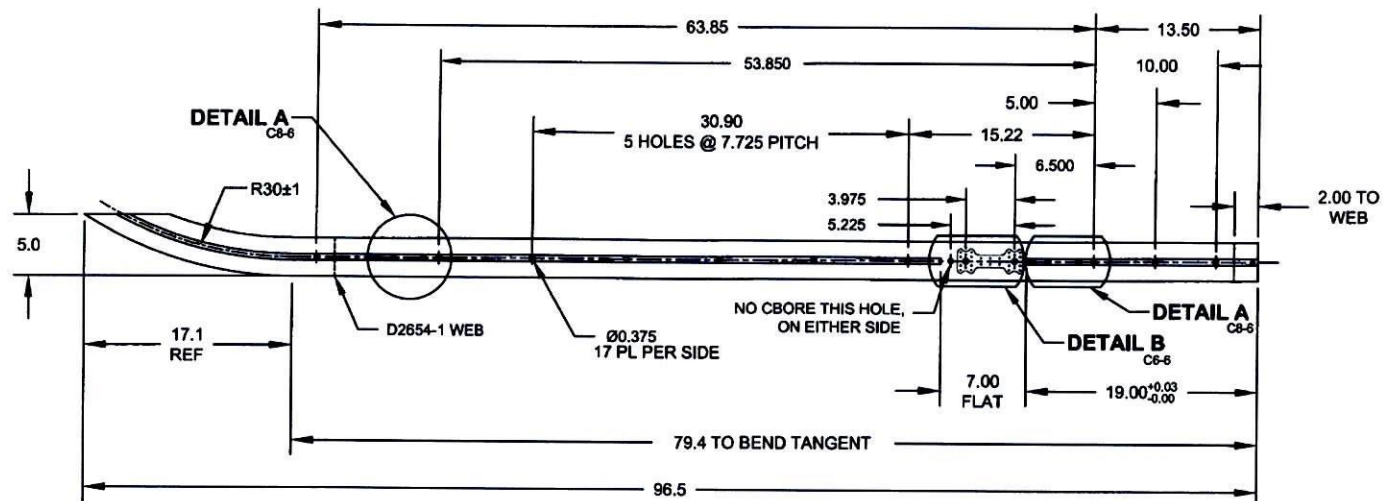


D2650-1 BENDING/DRILLING DETAIL

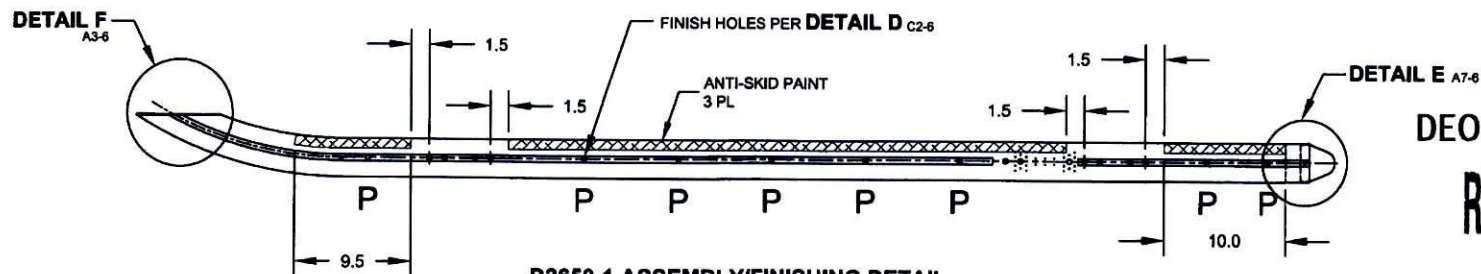


D2650-1 ASSEMBLY/FINISHING DETAIL

DEO ATTACHED
RELEASED
680922/114

DESIGN	DS	DART AEROSPACE USA, INC	
DRAWN	AJS	PORT HADLOCK, WA	
CHECKED		DRAWING NO.	REV. F
MFG. APPR.		D2650	SHEET 2 OF 6
APPROVED		TITLE	SCALE
DE APPR.		206/407 SKIDTUBE ASSEMBLIES	NTS
DATE	08.08.08	COPYRIGHT © 1987 BY DART AEROSPACE USA, INC THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

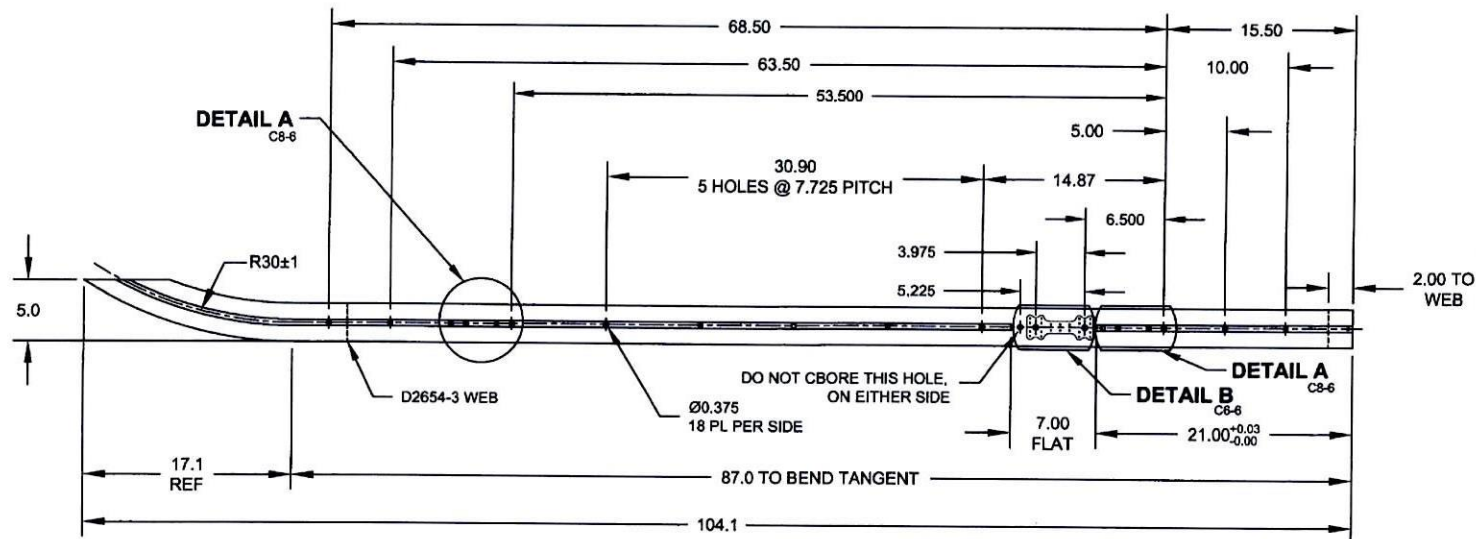



D2650-3 BENDING/DRILLING DETAIL

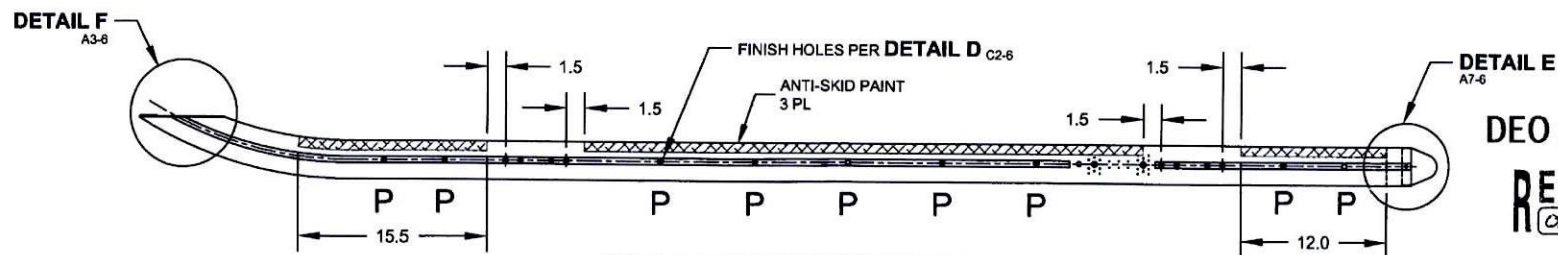

D2650-3 ASSEMBLY/FINISHING DETAIL

DEO ATTACHED
RELEASED
08 07 22 118


DESIGN	DS	DART AEROSPACE USA, INC	
DRAWN	AJS	PORT HADLOCK, WA	
CHECKED		DRAWING NO.	REV. F
MFG. APPR.		D2650	SHEET 3 OF 6
APPROVED		TITLE	SCALE
DE APPR.		206/407 SKIDTUBE ASSEMBLIES	NTS
DATE	08.08.08	COPYRIGHT © 1987 BY DART AEROSPACE USA, INC THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

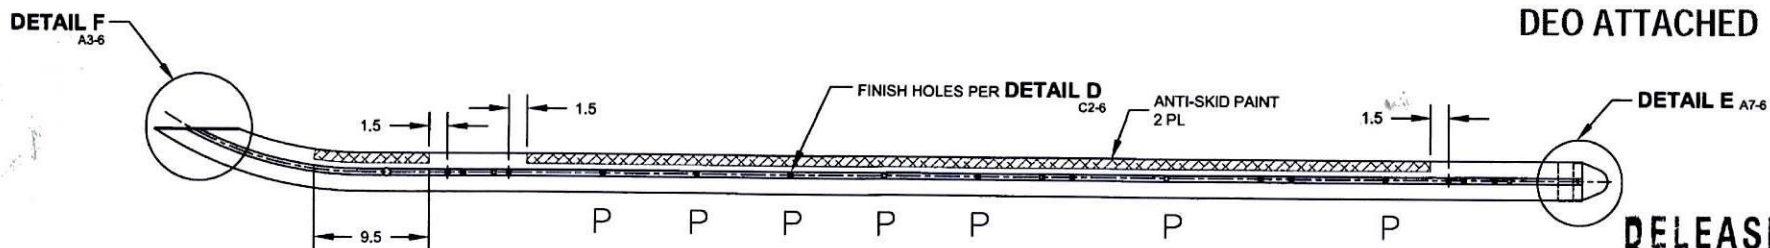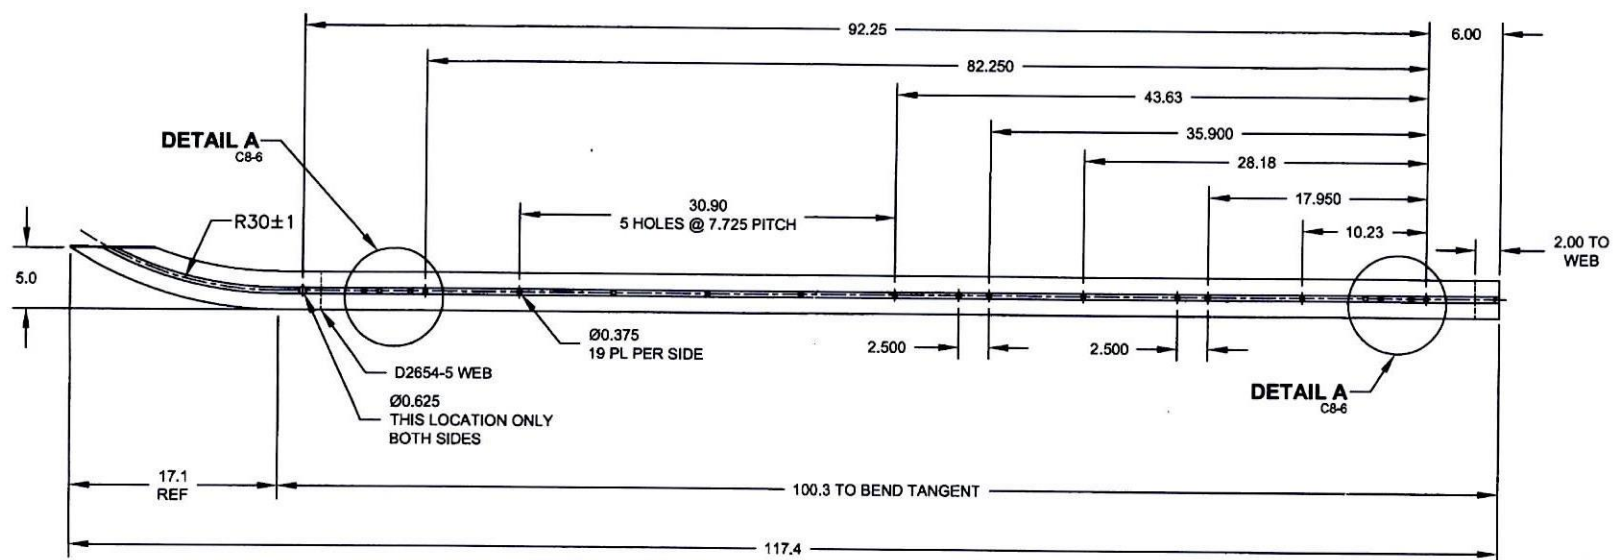



DEO ATTACHED

RELEASED



DESIGN	DS	DART AEROSPACE USA, INC	
DRAWN	A/S	PORT HADLOCK, WA	
CHECKED		DRAWING NO.	REV. F
MFG. APPR.		D2650	SHEET 4 OF 6
APPROVED		TITLE	SCALE
DE APPR.		206/407 SKIDTUBE ASSEMBLIES	NTS
DATE	08.08.08	COPYRIGHT © 1987 BY DART AEROSPACE USA, INC THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE REPRODUCED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

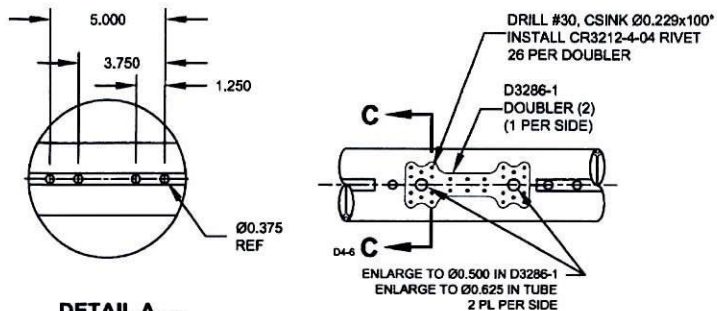

DETAIL B C3-2
SCALE 2X C3-3

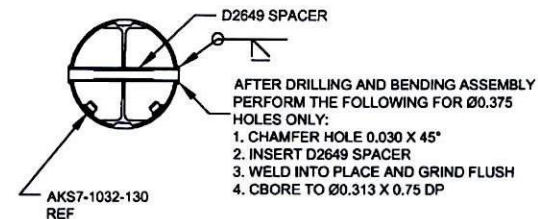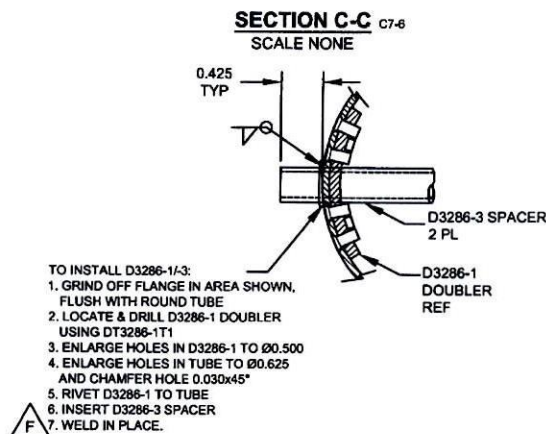

B4-2
B4-3
B4-4
B4-5

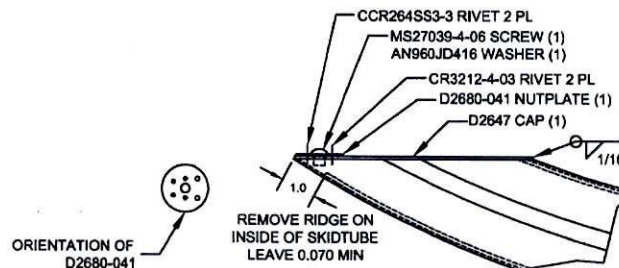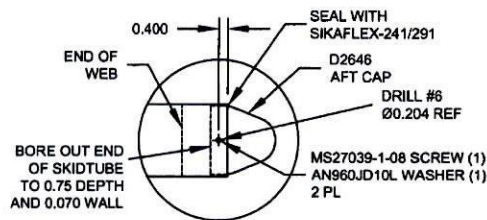

- DETAIL F NOTES:**
1. CUT TUBE LEVEL
 2. REMOVE RIDGE ON FWD SIDE
 3. LOCATE D2647 (TRIM AS NECESSARY)
 4. WELD D2647 IN PLACE PER DART QSI 004
 5. GRIND FLUSH
 6. RIVET D2680-041 NUT PLATE IN PLACE

NOTE: MASK THREADS IN D2680-041 PRIOR
TO FINISH

RELEASED
68 09 27-187
DEO ATTACHED

DESIGN	DS	DART AEROSPACE USA, INC	
DRAWN	AJS	PORT HADLOCK, WA	
CHECKED		DRAWING NO.	REV. F
MFG. APPR.		D2650	SHEET 6 OF 6
APPROVED		TITLE	SCALE
DE APPR.		206/407 SKIDTUBE ASSEMBLIES	NTS
DATE	08.08.08	COPYRIGHT © 1987 BY DART AEROSPACE USA, INC THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

DRAWING NO. D2650	TITLE 206/407 SKIDTUBE ASSEMBLIES	REV. F	DART AEROSPACE LTD ENGINEERING ORDER		D.E.O. NO. D2650-F-1	SHEET NO. SHEET 1 OF 1	SCALE NTS
DRAWN <i>[Signature]</i>	CHECKED A.P.	MFG. APPR. <i>[Signature]</i>	APPROVED <i>[Signature]</i>		DE APPR. <i>[Signature]</i>		
DATE 12.10.12	DATE 12.10.22	DATE 12.10.22	DATE 12.10.22		DATE 12.10.22		

PURPOSE:

CHANGE C'BORED WELDED CROSSBOLT SPACERS TO SWAGED SPACERS

CHANGE:

PARTS LIST IS AMENDED AS FOLLOWS:


IS:

QTY	QTY	QTY	QTY	PART NUMBER	DESCRIPTION
-1	-3	-5	-7		
1	1	0	0	D2649	CROSS BOLT SPACER
16	17	19	23	D4720-1	SPACER

WAS:

17	18	19	23	D2649	CROSS BOLT SPACER
----	----	----	----	-------	-------------------


ADD DETAIL G BELOW, WHICH IS THE SAME SECTION VIEW AS DETAIL D OF DWG.
C'BORED HOLES ARE **NOW SWAGED** PER DETAIL G BELOW. FOR THE Ø0.375 HOLE THAT IS NOT C'BORED, WELD PER DETAIL D OF DWG (SEE AMENDED DETAIL B FOR REFERENCE).

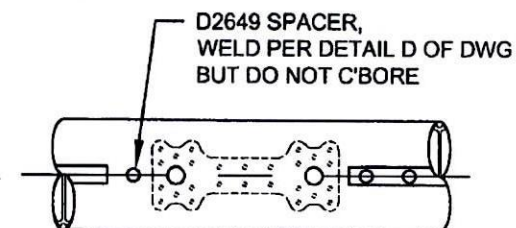

DETAIL B

AMENDMENT TO DETAIL B
NOT TO SCALE

RELEASED
2012-11-16
[Signature]

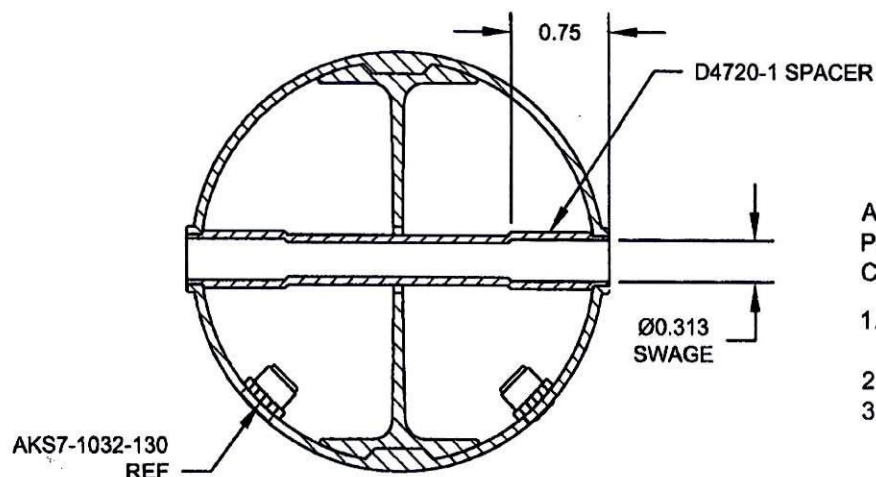

DETAIL G

FOR Ø0.375 HOLES ONLY
FOR HOLES THAT ARE CURRENTLY C'BORED ONLY
NOT TO SCALE

AFTER DRILLING AND BENDING ASSEMBLY
PERFORM THE FOLLOWING FOR Ø0.375 HOLES THAT ARE
CURRENTLY C'BORED:

1. INSERT D4720-1 SPACER, 16 PL (-1) OR 17 PL (-3)
OR 19 PL (-5) OR 23 PL (-7)
2. SWAGE TO Ø0.313 X 0.75 DP PER QSI 002
3. TRIM / GRIND FLUSH PER QSI 002